



Read these instructions carefully and thoroughly before beginning work.

Contents of Kit

Item	Qty.
1 Windshield with Mounting Bosses	1

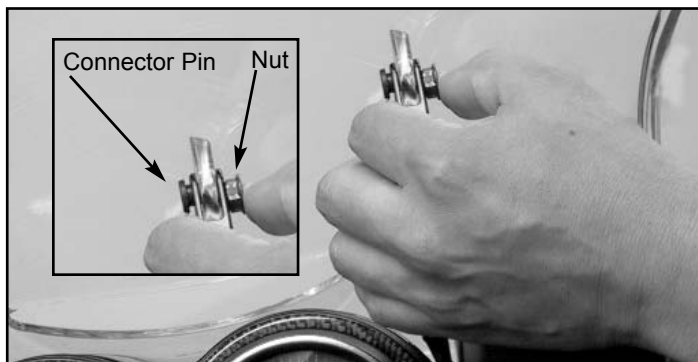


Figure 1.

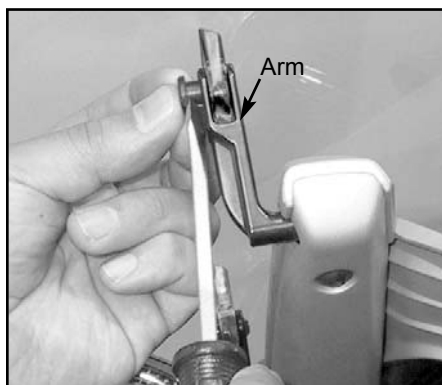


Figure 2.

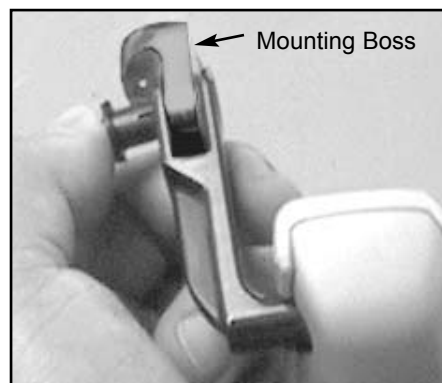


Figure 3.

Tools Required:

1/4 20 or 6mm Nut, any type
Flat Blade Screwdriver

INSTALLATION

NOTE: The mounting bosses attached to the **ZTechnik Replacement Windshield** are torqued to specification with a locking agent. Do not adjust these screws.

1. **With the windshield adjusted to its upper position** and starting at the upper mount points, from the outside, place the hole of the 1/4 20 or 6mm nut onto the end of a plastic connector pin and push. This will easily compress the four legs on the connector pin and release it from the arm and tab. **Figure 1.**
2. Use the flat blade screwdriver to carefully pry the plastic connector pin from the arm. Remove all four connector pins and save them for re-use. **Figure 2.**
3. Replace windshield with **ZTechnik Windshield.**
4. Starting with the lower mount points and working from the inside, insert the lower mounting bosses into the lower arms and fasten with the original plastic connector pin. Be sure to firmly push plastic connector pin through adjustment arm and mounting boss until it is fully seated and end of pin expands again as it exits the hole. **Figure 3.**
5. Repeat procedure 4 for all four mount points.

CAUTION: When windshield is in upper position make sure it does not contact the fairing surface. If it does, check the fairing for squareness and correct the problem.

MAINTENANCE To clean the screen, wash with a clean soft cloth, plenty of warm water and, if necessary, a non-abrasive soap such as dishwashing liquid. Flannel or soft chamois make good cleaning cloths. Paint, glue residue or grease removal: Moisten cotton with Naphtha or Turpentine followed by a wash as above. Apply a high quality plastic cleaner, such as McGuiar's Mirror-Glaze MG-17 or Novus #2, to the screen. This will leave a protective coating on the screen making future cleanings easier. Do not clean polycarbonate in hot sun or high temperatures.

Do not clean the screen with glass cleaners. Do not use rain protective products on the screen. The solvent action of the alcohol in these products will destroy the screen. Do not allow brake fluid, alcohol, or strong solvents to contact the screen or penetrate between the chrome brackets as permanent damage will result!